
## NOTES:

- 1. WHEN USING MULE—HIDE
  ALL—PURPOSE BAR TO TERMINATE
  WALL FLASHING, TPO BONDING
  ADHESIVE MAY BE ELIMINATED WHEN
  FLASHING HEIGHT IS 18" OR LESS.
- 2. FLASHING HEIGHT SHALL BE A MINIMUM OF 8" HIGH WHERE POSSIBLE. IF REMOVING COUNTERFLASHING DO NOT BLOCK OR COVER EXISTING WEEP HOLES. TERMINATION OF THE FLASHING MUST BE BELOW EXISTING WEEP HOLES.
- 3. ALL PURPOSE BAR FASTENED 6" ON CENTER IN 10' SECTIONS WITH ¼" GAP BETWEEN SECTIONS. ALL PURPOSE BAR IS TO BE INSTALLED WITH "BUMPS" FACING WALL. A FASTENER MUST BE LOCATED WITHIN 2" OF ENDS OF AP BAR. DO NOT BEND AP BAR AROUND INSIDE OR OUTSIDE CORNERS.
- 4. APPROXIMATELY 1/8" DIAMETER BEAD OF CUT-EDGE SEALANT IS REQUIRED ON CUT EDGES OF TPO REINFORCED MEMBRANE.

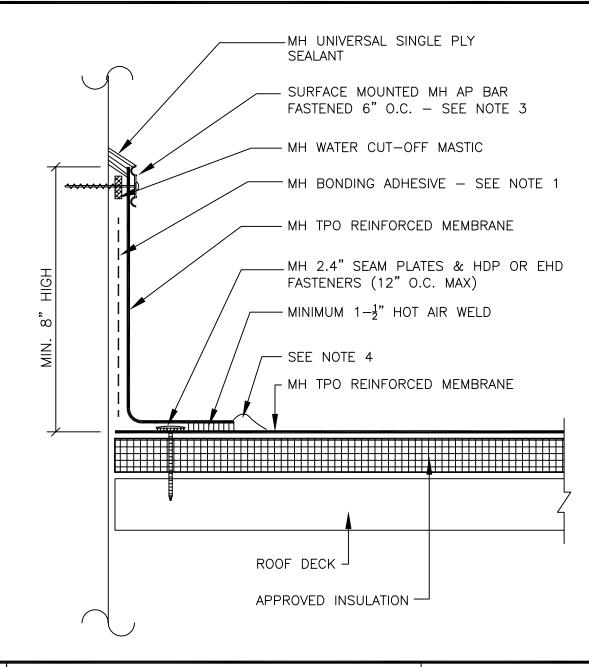

MULE-HIDE PRODUCTS CO., INC.

WALL FLASHING
WITH ALL-PURPOSE BAR
SYSTEMS:

**ALL TPO SYSTEMS** 

**DETAIL NO.:** 

**MHT-UN-312** 

REVISION DATE: 10/2

10/2013